



JEPPESEN[®]

Chart Alert

!! URGENT !!

Date: 19 August 2023

Subject: Seymour, Texas
Seymour Mun (60F)
RNAV (GPS) Rwy 17 (12-1)

Mislabeled of IAF waypoints.

On Jeppesen chart RNAV (GPS) Rwy 17 (12-1), dated 5 AUG 22, the initial approach fix waypoints ELECT and SNEED are mislabeled, and their locations should be reversed. The bearing from SNEED to ALNUT should be 139 degrees and a distance of 5.9 NM. The bearing from ELECT to ALNUT should be 227 degrees and a distance of 11.1 NM. The corrected chart will be available in the 13 OCT 23 revision.

**WE STRONGLY URGE YOU TO MAKE THIS INFORMATION AVAILABLE
TO APPROPRIATE CREW MEMBERS IMMEDIATELY!**

The corrected chart will be available in the 13 OCT 23 revision. This Chart Alert is also posted on the Jeppesen Web site: [Notices and Alerts](#).

If you have any questions concerning this Chart Alert, please contact Chart Support at:

+1 (303) 328-6776 (Western Hemisphere)

+49 (6102) 50-8174 (Eastern Hemisphere)

U.S. Toll Free: 1-800-353-2107

E-mail: ChartSupport@boeing.com

Chart Alerts are published to advise users of significant issues in Jeppesen chart data which may affect aircraft operations. Chart Alerts are distributed to chart Users and are also available on Jeppesen's Web site at www.jeppesen.com.